



# BRACKETT AERO FILTERS, INC.



## INSTRUCTIONS

ASSEMBLY PART NO. BA-2410

APPROVED ON AIRCRAFT MODELS: SEE FAA APPROVED APPLICABILITY LIST


REPLACE: Cessna Filter PN 125046-1

FAA APPROVAL DATA: STC-SA71GL List No. 1  
FAA-PMA Supplement No. 1

Your new polyurethane air filter element has been designed to provide maximum dust collecting efficiency, non-restrictive air flow, and economical element replacement, while maintaining a lightweight filter. The element has been treated with a distinctive treatment called a wetted agent and is approximately 98% efficient. The wetted agent is an accompaniment in the efficient capturing of dust. In addition, the element has received a fire retardant treatment. For the above reasons, replace the element each 200 hours of use/12 months or when 50% covered with foreign material. **DO NOT WASH AND REUSE.**

## INSTALLATION INSTRUCTIONS

- STEP 1. CAUTION: Be sure to install filter with the fine backfire screen on the two grills PN 2404 facing the foam element. The downstream grill PN 2404 is placed under the foam lip.
- STEP 2. Install filter assembly in the same manner as the original. Make sure the element is in place all around the frame. The element surrounding the grill PN 2402 also acts as the gasket. Push the bolts through the element and through the holes in the grills PN 2404 and torque in securely.
- STEP 3. NOTE: After initial installation of filter assembly, fill out FAA Form 337 for return to service. On future replacement of parts this form will not be required.

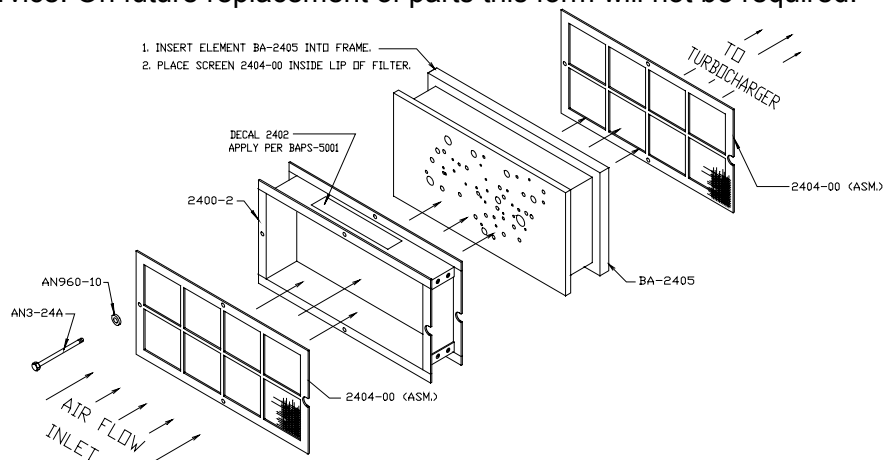

**SERVICING:** Under normal conditions, replace filter element, PN BA-2405 after 200 hours use or 1 year intervals. Under severely dusty conditions, check daily and replace when element is 50% covered with foreign material. For Continued Airworthiness Instructions, see Form I-194.

Instruction Sheet  
Part No. 2403  
Date Rev: 03-05-04

Mfg. by:  
BRACKETT AERO FILTERS, INC.  
Kingman, AZ

United States Of America  
Department of Transportation - Federal Aviation Administration  
**Supplemental Type Certificate**

*Number* SA71GL

*This Certificate issued to* BRACKETT AERO FILTERS, INC.  
7052 Government Way  
Kingman, Arizona 86401

*certifies that the change in the type design for the following product with the limitations and conditions therefor as specified hereon meets the airworthiness requirements of Part \* of the \* Regulations.*

*Original Product Type Certificate Number:* \* \*See attached Approved Model List (AML)

*Make:* \*(AML) No. SA71GL for list of approved aircraft

*Model:* \*models and applicable airworthiness regulations.

*Description of Type Design Change:* Installation of air filters in accordance with AML No. SA71GL dated April 17, 1995, or later FAA approved revision.

*Limitations and Conditions:* Approval of this change in type design applies to the above aircraft model(s) only. This approval should not be extended to aircraft of this model on which other previously approved modifications are incorporated unless it is determined that the interrelationship between this change and any of those other previously approved modifications will introduce no adverse effect upon the airworthiness of that aircraft. A copy of this Certificate and FAA Approved Model List (AML) No. SA71GL dated April 17, 1995, or later FAA approved revision must be maintained as part of the permanent records for the modified aircraft.

*This certificate and the supporting data which is the basis for approval shall remain in effect until surrendered, suspended, revoked or a termination date is otherwise established by the Administrator of the Federal Aviation Administration.*

*Date of application:* January 9, 1975

*Date reissued:* March 3, 1983, June 20, 2000

*Date of issuance:* February 21, 1975

*Date amended:* April 17, 1995



*By direction of the Administrator*

for Jim Liza Phalabanan  
(Signature)

Manager, Tech. and Admin. Support Staff  
Los Angeles Aircraft Certification Office  
(Title)

Any alteration of this certificate is punishable by a fine of not exceeding \$1,000, or imprisonment not exceeding 3 years, or both.

**FAA APPROVED MODEL LIST (AML) NO. SA71GL  
BRACKETT AERO FILTERS, INC.  
FOR  
INSTALLING AIR FILTERS**

Issue Date: April 17, 1995

ITEM	AIR FILTER MODEL NUMBER	TOP DRAWING		AIRCRAFT MAKE	AIRCRAFT MODEL	ORIGINAL TYPE CERTIFICATE NUMBER	CERT. BASIS	AML AMENDMENT DATE
		NUMBER	REVISION & DATE					
13	BA-2210L & R	BA-2210R & BA-2210L	A 10/1/85	Cessna	210D/E/F/G/H/J/K*/L*/M/N (thru SN 21064535 without air conditioner) *SN 21059200 thru 21061039 require both right and left filters	3A21	CAR 3	-----
				Cessna	207/A	A16CE	FAR 23	-----
				Cessna	P206/A/B/C/D/E, U206/A/B/C/D/E/F/G	A4CE	CAR 3	-----
*** END OF DATA ***								
14	BA-2310	BA-2310	C 9/4/85	Cessna	310F/G/H/I/J/K/L	3A10	CAR 3	-----
				*** END OF DATA ***				
15	BA-2410	BA-2410	C 12/17/94	Cessna	TU206A/B/C/D/E/F/G, TP206A/B/C/D/E	A4CE	CAR 3	-----
				Cessna	T207/A,	A16CE	FAR 23	-----
				Cessna	210N (SN 21064536 and UP), 210N (SN 21064136 and UP with air conditioner), 210R, T210F/G/H/J/K/L/M/N/R	3A21	CAR 3	-----
*** END OF DATA ***								
16	BA-2510	BA-2510-00	A 2/7/86	Cessna	R182, TR182, T182	3A13	CAR 3	-----
				Reims Aviation	(Cessna) FR182	A42EU	CAR 3	7/12/95
*** END OF DATA ***								

# BRACKETT AIR FILTER DOCUMENT I-194

PLACE IN AIRCRAFT RECORDS

CONTINUED AIRWORTHINESS INSPECTION  
 REQUIREMENTS AS PER FAR 23.1529  
 AND GENERAL PROCEDURES OF PART 43

**INSPECTION INTERVALS:** Pre-flight inspections, engine backfire inspection, 100 hour inspections, annual inspections, filter element replacements.

## INSPECTION PROCEDURES

- A. Pre-flight inspection: Per Pilots Operating Handbook, check filter assembly for security, damage or 50% contamination of element face. If found report to maintenance personnel prior to flight.
- B. Engine start-up backfire inspection: Prior to flight, check the entire intake system for security or damage. If a fire was present, the downstream face of the foam element will show erosion. If any irregularities are found see Chart I and also refer to the Aircraft Maintenance Manual for the intake system.
- C. At element replacement intervals: With the element removed, inspect the filter grill, filter frame, filter mountings and entire intake system for security, wear and any deformation. Note: On filter assemblies with gaskets, visually inspect inside and outside of frame for any signs of gasket looseness, movement or deterioration. If found refer to Chart I or the proper maintenance manual for your aircraft or component.

PART			INSTRUCTIONS
	REPLACE	REWORK	
FRAME	X		COMPLETE NEW ASSEMBLY
GASKET	X		ON FILTER FRAME, REMOVE OLD NEOPRENE GASKET AND ALL TRACES OF ADHESIVE DOWN TO A CLEAN ANODIZED FRAME SURFACE. USE ADHESIVE 3M#847 OR DOW CORNING RTV-732. COAT ENTIRE MATING SURFACE (GASKET TO FRAME). APPLY ADHESIVE FOLLOWING MANUFACTURER'S LABEL DIRECTIONS. WHEN FRAME AND GASKET ARE PLACED TOGETHER, CLAMP OR WEIGHT DOWN AT .75 LB./SQ. IN. OF CONTACT AREA. ALLOW TO CURE 24 HOURS PRIOR TO INSTALLATION. PRIOR TO REINSTALLATION OF FILTER, CHECK AIRBOX MATING SURFACE FOR IRREGULARITIES. IF FOUND, CORRECT PER MANUFACTURER'S REQUIREMENTS. UPON REINSTALLATION CHECK THAT THE GASKET MAKES 100% CONTACT. THE GASKET SHOULD BE COMPRESSED 50% FOR OPTIMUM SEAL.
GRILL	X		REPLACE WITH NEW GRILL
HARDWARE	X		REPLACE UNSERVICEABLE WITH NEW
SCREEN	X		COMPLETE NEW ASSEMBLY
SCREEN/GASKET	X		COMPLETE NEW ASSEMBLY ( ASSEMBLIES USING SCREEN GASKETS PRE 1981; BA-4106, BA-5110 AND BA-8110. )
ELEMENT	X		REPLACE ELEMENT